

Urenui and Onaero Beach Camps  
Monitoring Programme  
Annual Report  
2019-2020

Technical Report 2020-19

ISSN: 1178-1467 (Online)  
Document: 2479809 (Word)  
Document: 2546458 (Pdf)

Taranaki Regional Council  
Private Bag 713  
STRATFORD  
September 2020



## Executive summary

New Plymouth District Council (NPDC) operates the sewage disposal systems located at Urenui Beach Camp and Onaero Bay Holiday Park. NPDC holds resource consents to allow it to discharge septic tank treated sewage to groundwater via infiltration trenches at each of the beach camps. This report for the period July 2019 to June 2020 describes the monitoring programme implemented by the Taranaki Regional Council (the Council) to assess NPDC's environmental and consent compliance performance during the period under review. The report also details the results of the monitoring undertaken and assesses the environmental effects of the NPDC's activities.

NPDC holds one resource consent per beach camp, which each include a total of five special conditions setting out the requirements that NPDC must satisfy.

### **During the monitoring period, NPDC demonstrated an overall good level of environmental performance.**

The Council's monitoring programme for the year under review included three inspections per beach camp. One of these inspections included routine bacteriological sampling at four sites at Urenui and five sites at Onaero.

The bacteriological monitoring showed that the wastewater treatment systems at the beach camps did not adversely affect the water quality of local freshwater and coastal environments. Although high bacteriological results were returned from a site in Urenui during water quality sampling efforts, these counts could be attributed to either a discharge from the Urenui Township on the other side of the estuary, or other localised source of contamination. Elevated bacteriological counts are uncommon at the site in question. Subsequent sampling carried out as part of the Council's State of the Environment Recreational Bathing Monitoring Programme returned bacteriological counts more typical of historical results at the site.

There were two unauthorised incidents recording non-compliance in respect of NPDC during the period under review. Abatement notices were issued following self-notification from NPDC that data from flow meters at Urenui and Onaero showed that on multiple occasions, treated septic tank sewage effluent was discharged to groundwater in excess of consented limits. The flow exceedances were directly influenced by high rainfall, increasing inflow and infiltration into the sewer networks. The abatement notices have been extended until 31 December 2020 to allow suitable remedial actions to be scoped and implemented, noting that no adverse environmental effects have been detected as a result of the non-compliances. The Council is continuing to liaise closely with NPDC regarding the situation.

During the year, NPDC demonstrated a good level of environmental performance and a high level of administrative performance with the resource consents for the Urenui Beach Camp (2046-3) and the Onaero Bay Holiday Park (1389-3). This rating was influenced by the occurrence of the unauthorised incidents during the monitoring period, noting that there has been no adverse effect on the environment due to the unauthorised incidents. As a result, NPDC's environmental performance has declined in comparison to previous years.

For reference, in the 2019-2020 year, consent holders were found to achieve a high level of environmental performance and compliance for 81% of the consents monitored through the Taranaki tailored monitoring programmes, while for another 17% of the consents, a good level of environmental performance and compliance was achieved.

In terms of overall environmental and compliance performance by the consent holder over the last several years, this report shows that the consent holder's performance has deteriorated from a high level to a good level in the year under review.

This report includes recommendations for the 2020-2021 year.

## Table of contents

	Page	
1	Introduction	1
1.1	Compliance monitoring programme reports and the Resource Management Act 1991	1
1.1.1	Introduction	1
1.1.2	Structure of this report	1
1.1.3	The Resource Management Act 1991 and monitoring	1
1.1.4	Evaluation of environmental and administrative performance	2
1.2	Process description	3
1.2.1	Urenui Beach Camp	3
1.2.2	Onaero Bay Holiday Park	4
1.3	Resource consents	4
1.4	Monitoring programme	5
1.4.1	Introduction	5
1.4.2	Programme liaison and management	5
1.4.3	Site inspections	5
1.4.4	Bacteriological sampling	5
	1.4.4.1 Urenui Beach Camp	5
	1.4.4.2 Onaero Bay Holiday Park	7
2	Results	9
2.1	Urenui Beach Camp	9
2.1.1	Inspections	9
2.1.2	Results of receiving environment monitoring	9
2.1.3	Provision of consent holder data	10
2.2	Onaero Bay Holiday Park	11
2.2.1	Inspections	11
2.2.2	Results of receiving environment monitoring	11
2.2.3	Provision of consent holder data	12
2.3	Incidents, investigations, and interventions	12
3	Discussion	14
3.1	Discussion of site performance	14
3.1.1	Urenui Beach Camp	14
3.1.2	Onaero Bay Holiday Park	14
3.2	Environmental effects of exercise of consents	14

3.3	Evaluation of performance	14
3.4	Recommendations from the 2018-2019 Annual Report	16
3.5	Alterations to monitoring programmes for 2020-2021	16
4	Recommendations	18
	Glossary of common terms and abbreviations	19
	Bibliography and references	20
	Appendix I Resource consents held by the New Plymouth District Council	

## List of tables

Table 1	Resource consents held by NPDC, in relation to treated septic tank effluent discharges into groundwater, at the Urenui Beach Camp and Onaero Bay Holiday Park	4
Table 2	Locations of bacteriological sampling sites at Urenui Beach Camp in 2019-2020	5
Table 3	Locations of bacteriological sampling sites at Onaero Bay Holiday Park in 2019-2020	7
Table 4	Recreational bathing guidelines (MfE, 2003)	8
Table 5	Summary of previous bacteriological results, with <i>E. coli</i> measured in MPN/100 ml, enterococci (Ent) in cfu/100 ml, and electrical conductivity (EC) in mS/m@20°C, for Urenui Beach Camp (1993-2019)	9
Table 6	Bacteriological results for Urenui Beach Camp (7 January 2020)	10
Table 7	Summary of previous bacteriological results, with <i>E. coli</i> measured in MPN/100 ml, enterococci (Ent) in cfu/100 ml, and electrical conductivity (condy) in mS/m@20°C, for Onaero Bay Holiday Park (1993-2019)	11
Table 8	Bacteriological results for Onaero Bay Holiday Park (7 January 2020)	12
Table 9	Incidents, investigations, and interventions summary table	13
Table 10	Summary of performance for consent 2046-3	14
Table 11	Summary of performance for consent 1389-3	15
Table 12	Evaluation of environmental performance over time	15

## List of figures

Figure 1	Map of sampling sites, sewage disposal system and other features of interest at Urenui Beach Camp	6
Figure 2	Map of sampling sites, sewage disposal system and other features of interest at Onaero Bay Holiday Park	7
Figure 3	Urenui Domain supplied flow meter data	10
Figure 4	Onaero Domain supplied flow meter data	12

## List of photos

Photo 1	Urenui estuary and beach camp	4
Photo 2	Urenui Beach, December 2017	6
Photo 3	Onaero Beach, May 2015	8

# 1 Introduction

## 1.1 Compliance monitoring programme reports and the Resource Management Act 1991

### 1.1.1 Introduction

This report is for the period July 2019 to June 2020 by the Taranaki Regional Council (the Council) describing the monitoring programme associated with resource consents held by New Plymouth District Council (NPDC) for the disposal of treated sewage at the Urenui Beach Camp and Onaero Bay Holiday Park. NPDC operates the wastewater treatment systems at each of the beach camps.

This report covers the results and findings of the monitoring programme implemented by the Council in respect of the consents held by NPDC that relate to discharges of septic tank treated sewage effluent to groundwater via soakage trenches. This is the 30<sup>th</sup> report to be prepared by the Council to cover NPDC's water discharges and their effects.

### 1.1.2 Structure of this report

**Section 1** of this report is a background section. It sets out general information about:

- consent compliance monitoring under the *Resource Management Act 1991* (RMA) and the Council's obligations;
- the Council's approach to monitoring sites through annual programmes;
- the resource consents held by NPDC for the two beach camps;
- the nature of the monitoring programme in place for the period under review; and
- a description of the activities and operations conducted at the two beach camps.

**Section 2** presents the results of monitoring during the period under review, including scientific and technical data.

**Section 3** discusses the results, their interpretations, and their significance for the environment.

**Section 4** presents recommendations to be implemented in the 2020-2021 monitoring year.

A glossary of common abbreviations and scientific terms, and a bibliography, are presented at the end of the report.

### 1.1.3 The Resource Management Act 1991 and monitoring

The RMA primarily addresses environmental 'effects' which are defined as positive or adverse, temporary or permanent, past, present or future, or cumulative. Effects may arise in relation to:

- a. the neighbourhood or the wider community around an activity, and may include cultural and social-economic effects;
- b. physical effects on the locality, including landscape, amenity and visual effects;
- c. ecosystems, including effects on plants, animals, or habitats, whether aquatic or terrestrial;
- d. natural and physical resources having special significance (for example recreational, cultural, or aesthetic); and
- e. risks to the neighbourhood or environment.

In drafting and reviewing conditions on discharge permits, and in implementing monitoring programmes, the Council is recognising the comprehensive meaning of 'effects' inasmuch as is appropriate for each

activity. Monitoring programmes are not only based on existing permit conditions, but also on the obligations of the RMA to assess the effects of the exercise of consents. In accordance with Section 35 of the RMA, the Council undertakes compliance monitoring for consents and rules in regional plans, and maintains an overview of the performance of resource users and consent holders. Compliance monitoring, including both activity and impact monitoring, enables the Council to continually re-evaluate its approach and that of consent holders to resource management and, ultimately, through the refinement of methods and considered responsible resource utilisation, to move closer to achieving sustainable development of the region's resources.

#### 1.1.4 Evaluation of environmental and administrative performance

Besides discussing the various details of the performance and extent of compliance by NPDC, this report also assigns them a rating for their environmental and administrative performance during the period under review.

Environmental performance is concerned with actual or likely effects on the receiving environment from the activities during the monitoring year. Administrative performance is concerned with the Company's approach to demonstrating consent compliance in site operations and management including the timely provision of information to Council (such as contingency plans and water take data) in accordance with consent conditions.

Events that were beyond the control of the consent holder and unforeseeable (that is a defence under the provisions of the RMA can be established) may be excluded with regard to the performance rating applied. For example loss of data due to a flood destroying deployed field equipment.

The categories used by the Council for this monitoring period, and their interpretation, are as follows:

##### Environmental Performance

**High:** No or inconsequential (short-term duration, less than minor in severity) breaches of consent or regional plan parameters resulting from the activity; no adverse effects of significance noted or likely in the receiving environment. The Council did not record any verified unauthorised incidents involving environmental impacts and was not obliged to issue any abatement notices or infringement notices in relation to such impacts.

**Good:** Likely or actual adverse effects of activities on the receiving environment were negligible or minor at most. There were some such issues noted during monitoring, from self reports, or during investigations of incidents reported to the Council by a third party but these items were not critical, and follow-up inspections showed they have been dealt with. These minor issues were resolved positively, co-operatively, and quickly. The Council was not obliged to issue any abatement notices or infringement notices in relation to the minor non-compliant effects; however abatement notices may have been issued to mitigate an identified potential for an environmental effect to occur.

For example:

- High suspended solid values recorded in discharge samples, however the discharge was to land or to receiving waters that were in high flow at the time;
- Strong odour beyond boundary but no residential properties or other recipient nearby.

**Improvement required:** Likely or actual adverse effects of activities on the receiving environment were more than minor, but not substantial. There were some issues noted during monitoring, from self reports, or during investigations of incidents reported to the Council by a third party. Cumulative adverse effects of a persistent minor non-compliant activity could elevate a minor issue to this level. Abatement notices and infringement notices may have been issued in respect of effects.

**Poor:** Likely or actual adverse effects of activities on the receiving environment were significant. There were some items noted during monitoring, from self reports, or during investigations of incidents reported to the Council by a third party. Cumulative adverse effects of a persistent moderate non-compliant activity could elevate an 'improvement required' issue to this level. Typically there were grounds for either a prosecution or an infringement notice in respect of effects.

#### Administrative performance

**High:** The administrative requirements of the resource consents were met, or any failure to do this had trivial consequences and were addressed promptly and co-operatively.

**Good:** Perhaps some administrative requirements of the resource consents were not met at a particular time, however this was addressed without repeated interventions from the Council staff. Alternatively adequate reason was provided for matters such as the no or late provision of information, interpretation of 'best practical option' for avoiding potential effects, etc.

**Improvement required:** Repeated interventions to meet the administrative requirements of the resource consents were made by Council staff. These matters took some time to resolve, or remained unresolved at the end of the period under review. The Council may have issued an abatement notice to attain compliance.

**Poor:** Material failings to meet the administrative requirements of the resource consents. Significant intervention by the Council was required. Typically there were grounds for an infringement notice.

For reference, in the 2019-2020 year, consent holders were found to achieve a high level of environmental performance and compliance for 81% of the consents monitored through the Taranaki tailored monitoring programmes, while for another 17% of the consents, a good level of environmental performance and compliance was achieved.<sup>1</sup>

## 1.2 Process description

### 1.2.1 Urenui Beach Camp

The current sewage disposal system at Urenui Beach Camp has been in use since 1987. Prior to this, septic tank waste was pumped to a nearby cliff top and discharged to the sea below. This was found to be unsatisfactory, as the septic tank retention time was about 21 hours during the peak summer usage period, resulting in inadequate treatment of sewage.

With the current disposal system, the waste from the campsite receives primary treatment through a septic tank system and is then pumped to groundwater via soakage trenches located approximately 50 m from the edge of the cliff, to the northeast of the camp and golf course.

---

<sup>1</sup> The Council has used these compliance grading criteria for 15 years. They align closely with the 4 compliance grades in the MfE Best Practice Guidelines for Compliance, Monitoring and Enforcement, 2018



Photo 1 Urenui estuary and beach camp

## 1.2.2 Onaero Bay Holiday Park

The current sewage disposal system at the Onaero Bay Holiday Park has been in use since 1984. Prior to this, waste was collected in septic tanks and the overflow gravitated to a small pumping station on the northern side of the Onaero River. The septic tank waste was then pumped to the top of a nearby ridge and into a soakage pit (approximately 4x2x3 m). This was found to be unsatisfactory during the peak summer usage period, resulting in inadequate treatment of sewage.

The current disposal system treats waste from the campsite in a similar manner to the Urenui Beach Camp's wastewater treatment system. Waste receives primary treatment through a septic tank system and is then pumped to soakage trenches located on high ground, approximately 300 m away.

## 1.3 Resource consents

NPDC holds two resource consents, the details of which are summarised in the table below. Summaries of the conditions attached to each permit are set out in Section 3 of this report.

A summary of the various consent types issued by the Council is included Appendix I, as are copies of all permits held by NPDC during the period under review.

Table 1 Resource consents held by NPDC, in relation to treated septic tank effluent discharges into groundwater, at the Urenui Beach Camp and Onaero Bay Holiday Park

Consent number	Purpose	Granted	Review	Expires
<i>Water discharge permits</i>				
<b>2046-3</b>	To discharge treated septic tank sewage effluent via soakage trenches into groundwater in the vicinity of the Urenui River	6 December 2002	June 2015	1 June 2021
<b>1389-3</b>	To discharge treated septic tank effluent via soakage trenches into groundwater in the vicinity of the Onaero River	6 December 2002	June 2015	1 June 2021

## 1.4 Monitoring programme

### 1.4.1 Introduction

Section 35 of the RMA sets obligations upon the Council to gather information, monitor and conduct research on the exercise of resource consents within the Taranaki region. The Council is also required to assess the effects arising from the exercising of these consents and report upon them.

The Council may therefore make and record measurements of physical and chemical parameters, take samples for analysis, carry out surveys and inspections, conduct investigations and seek information from consent holders.

The monitoring programme for the Urenui and Onaero beach camps consisted of three primary components.

### 1.4.2 Programme liaison and management

There is generally a significant investment of time and resources by the Council in:

- ongoing liaison with resource consent holders over consent conditions and their interpretation and application;
- in discussion over monitoring requirements;
- preparation for any consent reviews, renewals or new consent applications;
- advice on the Council's environmental management strategies and content of regional plans; and
- consultation on associated matters.

### 1.4.3 Site inspections

The Urenui Beach Camp and Onaero Bay Holiday Park were both visited three times during the monitoring period. With regard to consents for the discharge to water, the main points of interest were plant processes with potential or actual discharges to receiving watercourses. Air inspections focused on site processes with associated actual and potential emission sources and characteristics, including potential odour, dust, noxious or offensive emissions. The neighbourhood was surveyed for environmental effects.

### 1.4.4 Bacteriological sampling

#### 1.4.4.1 Urenui Beach Camp

The Council undertook bacteriological sampling in conjunction with the first post-Christmas inspections in January 2020.

Samples were collected at four sites in conjunction with the Urenui Beach Camp: two river and two coastal sites (Photo 2). A description of each site is provided in Table 2, and the locations of the four sampling sites are shown in Figure 1. The bridge on State Highway 3 (Site 1) was previously used as the upstream sampling site. An alternative site, 1 km downstream at the footbridge (Site 1a), has been used since 2001 as Site 1 is no longer safe to sample from.

**Table 2** Locations of bacteriological sampling sites at Urenui Beach Camp in 2019-2020

Site	Location	Site code	GPS coordinates (NZTM)
1	Urenui River SH3 bridge	URN000420	1721404 - 5682968
1a	Urenui River footbridge	URN000440	1720608 - 5682914
2	Urenui River at mouth	URN000480	1720245 - 5683370

Site	Location	Site code	GPS coordinates (NZTM)
3	Sea coast approx. 200 m east of river mouth	SEA900072	1720582 - 5683563
4	Sea coast at east end of beach	SEA900070	1720803 - 5683667

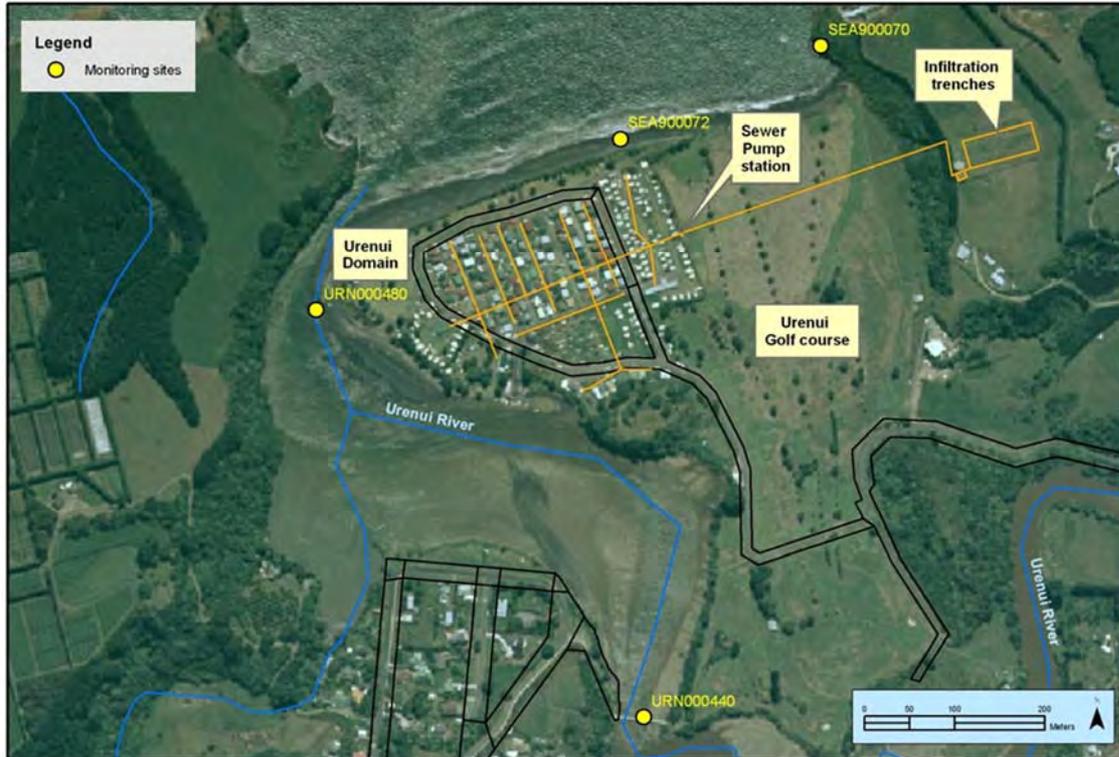


Figure 1 Map of sampling sites, sewage disposal system and other features of interest at Urenui Beach Camp



Photo 2 Urenui Beach, December 2017

### 1.4.4.2 Onaero Bay Holiday Park

Samples were collected at five routinely monitored sites in conjunction with the Onaero Bay Holiday Park, two river and three coastal sites (Photo 3). A description of each site monitored in the 2019-2020 monitoring period is provided in Table 3, and the locations of the five routinely monitored sampling sites are shown in Figure 2.

Table 3 Locations of bacteriological sampling sites at Onaero Bay Holiday Park in 2019-2020

Site	Location	Site code	GPS coordinates (NZTM)
1	Onaero River SH3 bridge	ONR000450	1718296 - 5682687
2	Onaero River at domain pump station bridge	ONR000470	1718283 - 5682895
3	Sea coast on beach adjacent to surf club	SEA900085	1718158 - 5683163
4	Sea coast beneath sewage infiltration cliff	SEA900083	1718216 - 5683212
5	Sea coast north of sewage infiltration cliff	SEA900081	1718296 - 5683239



Figure 2 Map of sampling sites, sewage disposal system and other features of interest at Onaero Bay Holiday Park



Photo 3 Onaero Beach, May 2015

Samples were analysed for temperature, conductivity and the faecal indicator bacteria (FIB), enterococci or *Escherichia coli* (*E. coli*). The FIB were monitored to provide an indication of potential contamination of the water by animal and/or human excreta. Electrical conductivity, which reflects the total ionic content of water, was measured as a supporting variable; conductivity indirectly relates to water composition as it correlates well with total dissolved solid concentrations (Davies-Colley, 2013).

Water quality at these sites is of particular interest as the beaches and rivers around the Urenui Beach Camp and Onaero Bay Holiday Park are popular summer swimming areas. In 2003, the Ministry for the Environment (MfE) developed the Guidelines for Recreational Water Quality to assess the safety of water for contact recreation. The coastal guidelines focus on enterococci as these bacteria have the ability to survive in marine water, providing the closest correlation with health effects in New Zealand coastal waters (MfE, 2003). For freshwater, the MfE (2003) guidelines use *E. coli* as the preferred indicator (Table 4). 'Alert' and 'Action' guideline levels are summarised in Table 4 and are based on keeping illness risk associated with recreational use to less than approximately 2%.

Table 4 Recreational bathing guidelines (MfE, 2003)

	Indicator	Mode		
		Surveillance	Alert	Action
Marine	Enterococci (cfu/100 ml)	No single sample >140	Single sample > 140	Two consecutive single samples >280
Freshwater	<i>E. coli</i> (cfu/100 ml)	No single sample >260	Single sample >260	Single sample >550

In addition to water quality monitoring during inspections, bacteriological samples were also collected from in front of the Onaero Surf Club (SEA900085) as part of the Council's State of Environment Monitoring Programme during the 2019-2020 monitoring period. Results from this programme are available in the Council's 2019-2020 Bathing Beach Water Quality State of the Environment Monitoring Report (TRC, 2020).

## 2 Results

### 2.1 Urenui Beach Camp

#### 2.1.1 Inspections

9 December 2019

The camp appeared to be relatively quiet at time of inspection. The camp manager reported no issues with the wastewater system so far this year. No odour or visual problems were noted at the pump station.

7 January 2020

The camp was fully booked at time of inspection, with the camp manager reporting that it had been extremely busy over the holiday period. At the time of inspection there was approximately 400 people in the camp, 100-200 people in the baches and members of the public around. The camp's wastewater treatment system had been operating without issue over summer and had been regularly maintained.

Water samples were collected during the inspection.

4 February 2020

The camp appeared to be relatively quiet at time of inspection with approximately 50 people camping and about 30 people in the baches. The camp manager reported no problems with the wastewater system. No odour or visual issues were noted at the pump station.

#### 2.1.2 Results of receiving environment monitoring

FIB have been sampled at the Urenui Beach Camp since 1987. A summary of historical bacteriological results from 1987 to 2019 is provided in Table 5. Median results indicate that FIB levels are typically lower at the river mouth than further upstream. This is likely due to a mixing effect at the river mouth, where seawater containing very low levels of FIB intrudes into the estuarine environment and dilutes the higher FIB counts of the riverine water. This is supported by a higher median electrical conductivity level at the river mouth than at the upstream site, due to the high ionic content and therefore electrical conductivity of seawater. These higher FIB counts are typically not reflected at the coastal sites, where even more mixing and dilution occurs where the river meets the Tasman Sea.

Table 5 Summary of previous bacteriological results, with *E. coli* measured in MPN/100 ml, enterococci (Ent) in cfu/100 ml, and electrical conductivity (EC) in mS/m@20°C, for Urenui Beach Camp (1993-2019)

	Site 1/1a		Site 2		Site 3		Site 4	
	<i>E. coli</i>	EC	<i>E. coli</i>	EC	Ent	EC	Ent	EC
Number of samples	23	26	24	26	26	25	27	26
Median	300	1,220	150	2,785	20	3,680	20	4,145
Minimum	8	192	4	144	0.5	1,560	1	1,480
Maximum	3,300	4,740	2,100	4,750	250	4,750	900	4,760

The results of the routine bacteriological monitoring undertaken during the 2019-2020 summer monitoring period are presented in Table 6. The *E. coli* count recorded at the footbridge located further upstream was below the respective historical median and the MfE 'Action' level for freshwater (Table 4). The *E. coli* count recorded at the river mouth was well above the respective historical medians and the MfE 'Action' level for

freshwater (Table 4). The high count seen at this site could be linked to stormwater from the Urenui Township on the other side of the estuary, or other localised source of contamination. Elevated bacteriological counts are uncommon at the site in question. Subsequent sampling carried out as part of the Council's State of the Environment Recreational Bathing Monitoring Programme returned bacteriological counts more typical of historical results at the site.

The enterococci counts at the coastal sites were similar to historical medians, and below the MfE 'Action' level for marine waters (Table 4).

Table 6 Bacteriological results for Urenui Beach Camp (7 January 2020)

Parameter	Unit	Site 1a	Site 2	Site 3	Site 4
Electrical conductivity	mS/m@20°C	2,680	3,460	4,690	4,230
<i>E. coli</i>	MPN/100 ml	207	1,733	-	-
Enterococci	cfu/100 ml	-	-	40	20

### 2.1.3 Provision of consent holder data

A flow meter within the wastewater treatment system was installed by NPDC in December 2019 at Urenui Beach Camp, in order to comply with condition 3 of consent 1389-3. NPDC complied with this data request and provided daily records of effluent volumes discharged to the soakage trenches between 17 December 2019 and 31 June 2020. From the period the flow meter was installed, the Urenui Beach Camp exceeded the consent limit of 85 m<sup>3</sup>/day for 28% of the period.

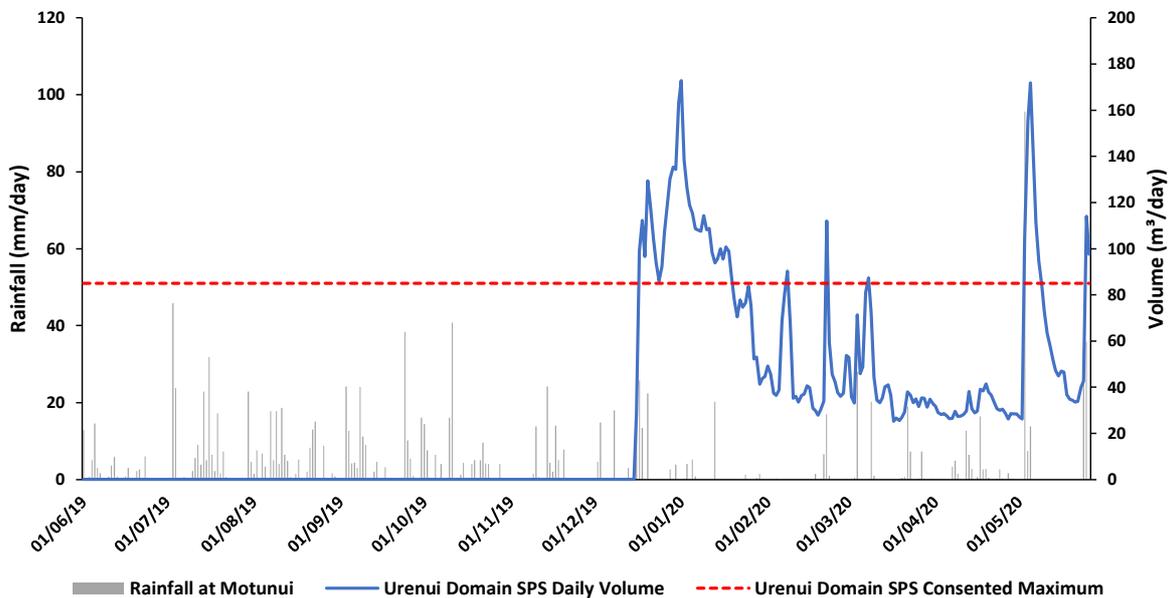


Figure 3 Urenui Domain supplied flow meter data

## 2.2 Onaero Bay Holiday Park

### 2.2.1 Inspections

9 December 2019

The camp appeared quiet at the time of inspection. No odours or visual issues were noted at the pump station or soakage trenches during the inspection. The location of the soakage trenches, as indicated by the grass colouration, had become very close to the edge of the cliff due to ongoing erosion. The camp manager reported a sewage smell during the afternoons from the pump station area.

7 January 2020

A camp staff member was present at the time of the inspection and reported that there was approximately 100 campers present on the site. Over the holiday period it was reported that the camp was full and there were 500-700 campers. It was reported that there had been odour issues over the holiday period and Citycare workers had been on site every couple of days to try to fix the odour problem. There had been issues with some of the seals in the wastewater treatment system but was reported that it had been fixed the previous day.

Water samples were collected on this occasion.

4 February 2020

The camp appeared quiet at the time of inspection with one person camping and some others in the permanent caravans and batches. No odours or visual issues were noted at the pump station or soakage trenches during the inspection. The camp manager was not present at the time of inspection.

### 2.2.2 Results of receiving environment monitoring

FIB have been sampled for at the Onaero Bay Holiday Park since 1987. A summary of historical bacteriological results from 1987 to 2019 is presented in Table 7.

Median results indicate that FIB levels and conductivity are typically higher at the bridge below the beach camp's pump station, compared with the upstream sample. These higher FIB counts are typically not reflected at the coastal sites, where extensive mixing and dilution occurs where the river meets the Tasman Sea.

Table 7 Summary of previous bacteriological results, with *E. coli* measured in MPN/100 ml, enterococci (Ent) in cfu/100 ml, and electrical conductivity (condy) in mS/m@20°C, for Onaero Bay Holiday Park (1993-2019)

	Site 1		Site 2		Site 3		Site 4		Site 5	
	<i>E. coli</i>	Condy	<i>E. coli</i>	Condy	Ent	Condy	Ent	Condy	Ent	Condy
Number of samples	25	26	26	28	27	26	26	25	23	22
Median	460	104	625	160	80	4,040	34	4,340	35	4,445
Minimum	77	10	69	11	1	757	3	603	1	2,280
Maximum	2,400	2,000	2,420	4,680	4,000	4,740	1,200	4,710	1,100	4,680

Table 8 shows the results of the bacteriological monitoring undertaken during the 2019-2020 monitoring year at the five sampling sites. The *E. coli* counts recorded at the two routinely monitored riverine sites were below the MfE 'Action' level for freshwater (Table 4). Enterococci counts at the coastal sites were also below

the MfE 'Action' level for marine waters (Table 4). The FIB counts at these sites were similar or below the respective historical medians. The results of this sampling run provided no evidence to suggest that the pump station or soakage trenches were adversely affecting freshwater or coastal water quality.

Table 8 Bacteriological results for Onaero Bay Holiday Park (7 January 2020)

Parameter	Unit	Site 1	Site 2	Site 3	Site 4	Site 5
Electrical conductivity	mS/m@20°C	15.4	19.4	4,310	4,380	4,840
<i>E. coli</i>	MPN/100 ml	117	141	-	-	-
Enterococci	cfu/100 ml	-	-	30	40	9

### 2.2.3 Provision of consent holder data

A flow meter within the wastewater treatment system was installed by NPDC in December 2019 at Onaero Beach Camp, in order to comply with condition 3 of consent 1389-3. NPDC complied with this data request and provided daily records of effluent volumes discharged to the soakage trenches between 20 December 2019 and 31 June 2020. From the period the flow meter was installed, the Onaero Beach Camp exceeded the consent limit of 17 m<sup>3</sup>/day for 12% of the period.

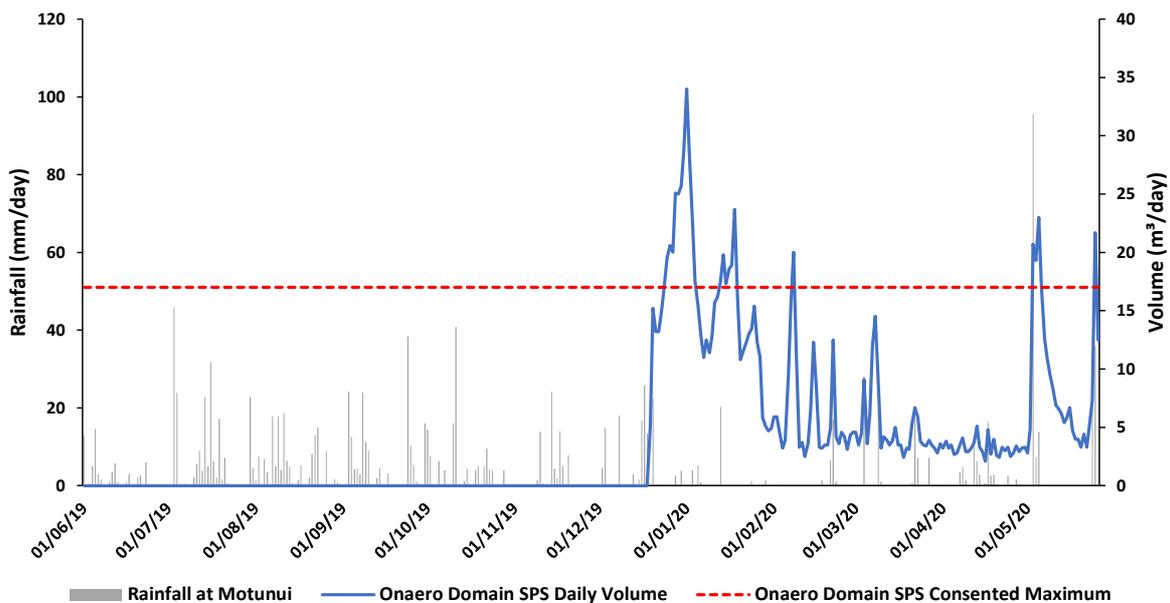


Figure 4 Onaero Domain supplied flow meter data

## 2.3 Incidents, investigations, and interventions

The monitoring programme for the year was based on what was considered to be an appropriate level of monitoring, review of data, and liaison with NPDC. During the year matters may arise which require additional activity by the Council, for example provision of advice and information, or investigation of potential or actual causes of non-compliance or failure to maintain good practices. A pro-active approach, that in the first instance avoids issues occurring, is favoured.

For all significant compliance issues, as well as complaints from the public, the Council maintains a database record. The record includes events where the individual/organisation concerned has itself notified the Council. Details of any investigation and corrective action taken are recorded for non-compliant events.

Complaints may be alleged to be associated with a particular site. If there is potentially an issue of legal liability, the Council must be able to prove by investigation that the identified individual/organisation is indeed the source of the incident (or that the allegation cannot be proven).

Table 9 below sets out details of any incidents recorded, additional investigations, or interventions required by the Council in relation to NPDC's activities during the 2019-2020 period. This table presents details of all events that required further investigation or intervention regardless of whether these were found to be compliant or not.

**Table 9 Incidents, investigations, and interventions summary table**

Date	Details	Compliant (Y/N)	Enforcement Action Taken?	Outcome
21/02/2020	Self-notification was received concerning an unauthorised discharge of wastewater from the Urenui Beach Camp near Urenui.	N	Abatement notice	Abatement notice extended until 31 December 2020
21/02/2020	Self-notification was received concerning an unauthorised discharge of wastewater from the Onaero Beach Camp, Onaero.	N	Abatement notice	Abatement notice extended until 31 December 2020

Self-notification data received from flow meters at Urenui and Onaero showed that on multiple occasions, treated septic tank sewage effluent was discharged to groundwater in excess of the consented limits. NPDC has commissioned an Assessment of Environmental Effects and is planning for an improved system with additional measures such as monitoring of the discharges and receiving environments, reduction of inflow and infiltration, monitoring and limiting occupancy of the campgrounds, improvement to system buffering capacity, and investigations into alternative infrastructure for wastewater treatment at both sites. The abatement notices have been extended until 31 December 2020 to enable suitable actions to be scoped and implemented, noting that no adverse environmental effects have been detected as a result of the non-compliances. The Council is continuing to liaise closely with NPDC regarding the situation.

## 3 Discussion

### 3.1 Discussion of site performance

#### 3.1.1 Urenui Beach Camp

No visual issues or offensive odours were noted during any of the three inspections, and no issues with the wastewater treatment system were reported by the camp manager over the 2019-2020 monitoring period. After instillation of a flow meter at the beach camp in December, the daily discharge was found to be greater than the consent limit on multiple occasions. An abatement notice was issued on 21 February 2020 after self-notification received from NPDC concerning unauthorised discharge of wastewater.

#### 3.1.2 Onaero Bay Holiday Park

No odours or visual issues were noted at the pump station during the Council's summer inspections. It was reported by the camp manager that there had been odour issues over the busy holiday period and Citycare workers had been on site every couple of days to try fix the odour problem. There had been issues with some of the seals in the wastewater treatment system, but was reported that it had been fixed. After instillation of a flow meter at the beach camp in December, the daily discharge was found to be greater than the consent limit on multiple occasions. An abatement notice was issued on 21 February 2020 after self-notification received from NPDC concerning unauthorised discharge of wastewater.

### 3.2 Environmental effects of exercise of consents

Water quality monitoring was undertaken in the Urenui River, Onaero River and adjacent coastal waters during the period under review. The samples did not detect any adverse effects caused by the beach camps' wastewater systems.

### 3.3 Evaluation of performance

A tabular summary of NPDC's compliance record for the year under review is provided in Tables 10 and 11.

Table 12 sets out a summary of environmental performance by NPDC over time.

Table 10 Summary of performance for consent 2046-3

<b>Purpose: To discharge up to 85 cubic meters/day of treated septic tank sewage effluent in the vicinity of the Urenui River</b>		
<b>Condition requirement</b>	<b>Means of monitoring during period under review</b>	<b>Compliance achieved?</b>
1. Bacteriological monitoring of Urenui River and coastal foreshore	Sample collection	Yes
2. Consent holder to maintain septic tank system as required	Site inspections, liaison with camp management	Yes
3. Records of daily effluent volumes if requested	Flow meter installed in December 2019, with data provided monthly by NPDC	Yes
4. Contingency plan	NPDC Water & Wastes Incident Response Plan version 10.5, received February 2019	Yes
5. Optional review provision re. environmental effects	No further provisions for review; expires 1 June 2021	N/A

<b>Purpose: To discharge up to 85 cubic meters/day of treated septic tank sewage effluent in the vicinity of the Urenui River</b>		
<b>Condition requirement</b>	<b>Means of monitoring during period under review</b>	<b>Compliance achieved?</b>
Overall assessment of consent compliance and environmental performance in respect of this consent		<b>Good High</b>
Overall assessment of administrative performance in respect of this consent		

N/A = not applicable

Table 11 Summary of performance for consent 1389-3

<b>Purpose: To discharge up to 17 cubic meters/day of treated septic tank sewage effluent in the vicinity of the Onaero River</b>		
<b>Condition requirement</b>	<b>Means of monitoring during period under review</b>	<b>Compliance achieved?</b>
1. Bacteriological monitoring of Onaero River and coastal foreshore	Sample collection	Yes
2. Consent holder to maintain septic tank system as required	Site inspections, liaison with camp management	Yes
3. Records of daily effluent volumes if requested	Flow meter installed in December 2019, with data provided monthly by NPDC	Yes
4. Contingency plan	NPDC Water & Wastes Incident Response Plan version 10.5, received February 2019	Yes
5. Optional review provision re environmental effects	No further provisions for review; expires 1 June 2021	N/A
Overall assessment of consent compliance and environmental performance in respect of this consent		<b>Good High</b>
Overall assessment of administrative performance in respect of this consent		

N/A = not applicable

Table 12 Evaluation of environmental performance over time

<b>Year</b>	<b>Consent no</b>	<b>High</b>	<b>Good</b>	<b>Improvement req</b>	<b>Poor</b>
2010-2011	2046	1	-	-	-
	1389	1	-	-	-
2011-2012	2046	1	-	-	-
	1389	1	-	-	-
2012-2014	2046	1	-	-	-
	1389	-	-	1	-
2014-2015	2046	1	-	-	-
	1389	1	-	-	-
2015-2016	2046	1	-	-	-
	1389	1	-	-	-

Year	Consent no	High	Good	Improvement req	Poor
2016-2017	2046	1	-	-	-
	1389	1	-	-	-
2017-2018	2046	1	-	-	-
	1389	1	-	-	-
2018-2019	2046	-	1	-	-
	1389	1	-	-	-
2019-2020	2046	-	1	-	-
	1389	-	1	-	-
Total	2046	7	2	0	0
	1389	7	1	1	0

During the year, NPDC demonstrated a good level of environmental performance and a high level of administrative performance with the resource consents as defined in Section 1.1.4. By comparison with previous years, the monitoring indicated a decline in environmental performance.

There were two unauthorised incidents recording non-compliance in respect of consent 2046-3 and 1389-3 during the period under review. Abatement notices were issued as self-notification data received from flow meters at Urenui and Onaero showed that on multiple occasions, treated septic tank sewage effluent was discharged to groundwater in excess of consented limits.

### 3.4 Recommendations from the 2018-2019 Annual Report

In the 2018-2019 Annual Report, it was recommended:

1. THAT monitoring of consented activities at the beach camps in the 2019-2020 year be amended from that undertaken in 2018-2019, by incorporating inspections of the soakage trenches at the beach camps during routine site inspections, to check for any evidence of effluent ponding at the surface.
2. THAT should there be issues with environmental or administrative performance in 2019-2020, monitoring may be adjusted to reflect any additional investigation or intervention as found necessary.

These recommendations were implemented in full.

### 3.5 Alterations to monitoring programmes for 2020-2021

In designing and implementing the monitoring programmes for air/water discharges in the region, the Council has taken into account:

- the extent of information already made available through monitoring or other means to date;
- its relevance under the RMA;
- the Council's obligations to monitor consented activities and their effects under the RMA;
- the record of administrative and environmental performances of the consent holder; and
- reporting to the regional community.

The Council also takes into account the scope of assessments required at the time of renewal of permits, and the need to maintain a sound understanding of industrial processes within Taranaki exercising resource consents.

It is proposed that for 2020-2021, the monitoring programme for the Urenui and Onaero Beach Camps monitoring programme remains unchanged.

It should be noted that the proposed programme represents a reasonable and risk-based level of monitoring for the sites in question. The Council reserves the right to subsequently adjust the programme from that initially prepared, should the need arise if potential or actual non-compliance is determined at any time during 2020-2021.

## 4 Recommendations

1. THAT monitoring of consented activities at the beach camps in the 2020-2021 year continue at the same level as in 2019-2020.
2. THAT should there be issues with environmental or administrative performance in 2020-2021, monitoring may be adjusted to reflect any additional investigation or intervention as found necessary.

## Glossary of common terms and abbreviations

The following abbreviations and terms may be used within this report:

cfu	Colony forming units. A measure of the concentration of bacteria usually expressed as per 100 millilitre sample.
Conductivity	Conductivity, an indication of the level of dissolved salts in a sample, usually measured at 25°C and expressed in mS/m.
Contact recreation	Recreational activities that bring people physically in contact with water, involving a risk of involuntary ingestion or inhalation of water.
<i>E. coli</i>	<i>Escherichia coli</i> , an indicator of the possible presence of faecal material and pathological micro-organisms. Usually expressed as colony forming units per 100 millilitre sample.
Ent	Enterococci, an indicator of the possible presence of faecal material and pathological micro-organisms. Usually expressed as colony forming units per 100 millilitre of sample.
Incident	An event that is alleged or is found to have occurred that may have actual or potential environmental consequences or may involve non-compliance with a consent or rule in a regional plan. Registration of an incident by the Council does not automatically mean such an outcome had actually occurred.
Intervention	Action/s taken by Council to instruct or direct actions be taken to avoid or reduce the likelihood of an incident occurring.
Investigation	Action taken by Council to establish what were the circumstances/events surrounding an incident including any allegations of an incident.
Incident Register	The Incident Register contains a list of events recorded by the Council on the basis that they may have the potential or actual environmental consequences that may represent a breach of a consent or provision in a Regional Plan.
Median	Central value when values are arranged in order of magnitude.
MPN	Most Probable Number. A method used to estimate the concentration of viable microorganisms in a sample.
mS/m	Millisiemens per metre.
Resource consent	Refer Section 87 of the RMA. Resource consents include land use consents (refer Sections 9 and 13 of the RMA), coastal permits (Sections 12, 14 and 15), water permits (Section 14) and discharge permits (Section 15).
RMA	<i>Resource Management Act 1991</i> and including all subsequent amendments.
Water quality	The bacteriological condition of a water body as it relates to human health, measured using indicator bacteria.

For further information on analytical methods, contact a Science Services Manager.

## Bibliography and references

- Davies-Colley, R. J. (2013). River water quality in New Zealand: an introduction and overview. *Ecosystem services in New Zealand: conditions and trends*. Manaaki Whenua Press, Lincoln, 432-447.
- Ministry for the Environment (2003): *Microbiological Water Quality Guidelines for Marine and Freshwater Recreational Areas*. Ministry for the Environment, Wellington.
- Taranaki Regional Council (2019): *Bathing Beach Recreational Water Quality State of the Environment Monitoring Report Summer 2018-2019*. Technical Report 2019-36.
- Taranaki Regional Council (2019): *Urenui and Onaero Beach Camps Monitoring Programme Annual Report 2018-2019*. Technical Report 2019-09.
- Taranaki Regional Council (2018): *Bathing Beach Recreational Water Quality State of the Environment Monitoring Report Summer 2017-2018*. Technical Report 2018-33.
- Taranaki Regional Council (2018): *Urenui and Onaero Beach Camps Monitoring Programme Annual Report 2017-2018*. Technical Report 2018-13.
- Taranaki Regional Council (2017): *Bathing Beach Recreational Water Quality State of the Environment Monitoring Report Summer 2016-2017*. Technical Report 2017-2.
- Taranaki Regional Council (2017): *Urenui and Onaero Beach Camps Monitoring Programme Annual Report 2016-2017*. Technical Report 2017-34.
- Taranaki Regional Council (2016): *Urenui and Onaero Beach Camps Monitoring Programme Annual Report 2015-2016*. Technical Report 2016-108.
- Taranaki Regional Council (2015): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 2014-2015*. Technical Report 2015-16.
- Taranaki Regional Council (2014): *Bathing Beach Water Quality State of the Environment Monitoring Report Summer 2013-2014*. Technical Report 2014-13.
- Taranaki Regional Council (2014): *Urenui and Onaero Motor Camps Monitoring Programme Biennial Report 2012-2014*. Technical Report 14-76.
- Taranaki Regional Council (2013): *Bathing Beach Water Quality State of the Environment Monitoring Report Summer 2012-2013*. Technical Report 2013-17.
- Taranaki Regional Council (2012): *Bathing Beach Water Quality State of the Environment Monitoring Report Summer 2011-2012*. Technical Report 2012-19.
- Taranaki Regional Council (2012): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 2011-2012*. Technical Report 12-01.
- Taranaki Regional Council (2011): *Bathing Beach Water Quality State of Environment Monitoring Report Summer 2010-2011*. Technical Report 11-15.
- Taranaki Regional Council (2011): *Freshwater Contact Recreational Water Quality at Selected Taranaki Sites State of Environment Monitoring Report Summer 2010-2011*. Technical Report 11-01.
- Taranaki Regional Council (2011): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 2009-2010*. Technical Report 11-02.
- Taranaki Regional Council (2010): *Bathing Beach Water Quality State of Environment Monitoring Report Summer 2009-2010*. Technical Report 10-08.

- Taranaki Regional Council (2010): *Freshwater Contact Recreational Water Quality at Selected Taranaki Sites State of Environment Monitoring Report Summer 2009-2010*. Technical Report 10-11.
- Taranaki Regional Council (2010): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 2009-2010*. Technical Report 10-05.
- Taranaki Regional Council (2009): *Bathing Beach Water Quality State of Environment Monitoring Report Summer 2008-2009*. Technical Report 09-11.
- Taranaki Regional Council (2009): *Freshwater Contact Recreational Water Quality at Selected Taranaki Sites State of Environment Monitoring Report Summer 2008-2009*. Technical Report 09-12.
- Taranaki Regional Council (2009): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 2008-2009*. Technical Report 09-06.
- Taranaki Regional Council (2008): *Bathing Beach Water Quality State of Environment Monitoring Report Summer 2007-2008*. Technical Report 08-01.
- Taranaki Regional Council (2008): *Freshwater Contact Recreational Water Quality at Selected Taranaki Sites State of Environment Monitoring Report Summer 2007-2008*. Technical Report 08-02.
- Taranaki Regional Council (2008): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 2007-2008*. Technical Report 08-19.
- Taranaki Regional Council (2007): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 2006-2007*. Technical Report 07-21.
- Taranaki Regional Council (2006): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 2005-2006*. Technical Report 06-35.
- Taranaki Regional Council (2005): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 2004-2005*. Technical Report 05-28.
- Taranaki Regional Council (2004): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 2003-2004*. Technical Report 04-10.
- Taranaki Regional Council (2003): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 2002-2003*. Technical Report 03-08.
- Taranaki Regional Council (2002): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 2001-2002*. Technical Report 02-23.
- Taranaki Regional Council (2001): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 2000-2001*. Technical Report 01-35.
- Taranaki Regional Council (2000): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 1999-2000*. Technical Report 00-09.
- Taranaki Regional Council (1999): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 1998-99*. Technical Report 99-19.
- Taranaki Regional Council (1998): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 1997-98*. Technical Report 98-27.
- Taranaki Regional Council (1997): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 1996-97*. Technical Report 97-18.
- Taranaki Regional Council (1996): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 1995-1996*. Technical Report 96-14.

Taranaki Regional Council (1995): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 1994-1995*. Technical Report 95-20.

Taranaki Regional Council (1994): *Urenui and Onaero Motor Camps Monitoring Programme Annual Report 1993-1994*. Technical Report 94-6.

Taranaki Regional Council (1993): *Urenui and Onaero Beach Camps Monitoring Programmes Annual Report 1992-1993*. Technical Report 93-6.

Taranaki Regional Council (1992): *Urenui and Onaero Beach Camps Monitoring Programmes Annual Report 1991-1992*. Technical Report 92-12.

Taranaki Regional Council (1991): *Urenui and Onaero Beach Camps Monitoring Programmes Annual Report 1990-1991*. Technical Report 91-1.

Taranaki Regional Council (1990): *Onaero and Urenui Beach Resorts Monitoring Programme Annual Report 1989-1990*. Technical Report 90-36.

Taranaki Regional Council (1990): *Bacteriological Survey of Selected Taranaki Coastal Recreational Streams: Summer 1989-1990*. Technical Report 90-13.

## Appendix I

Resource consents held by  
the New Plymouth District Council

## Water abstraction permits

Section 14 of the RMA stipulates that no person may take, use, dam or divert any water, unless the activity is expressly allowed for by a resource consent or a rule in a regional plan, or it falls within some particular categories set out in Section 14. Permits authorising the abstraction of water are issued by the Council under Section 87(d) of the RMA.

## Water discharge permits

Section 15(1)(a) of the RMA stipulates that no person may discharge any contaminant into water, unless the activity is expressly allowed for by a resource consent or a rule in a regional plan, or by national regulations. Permits authorising discharges to water are issued by the Council under Section 87(e) of the RMA.

## Air discharge permits

Section 15(1)(c) of the RMA stipulates that no person may discharge any contaminant from any industrial or trade premises into air, unless the activity is expressly allowed for by a resource consent, a rule in a regional plan, or by national regulations. Permits authorising discharges to air are issued by the Council under Section 87(e) of the RMA.

## Discharges of wastes to land

Sections 15(1)(b) and (d) of the RMA stipulate that no person may discharge any contaminant onto land if it may then enter water, or from any industrial or trade premises onto land under any circumstances, unless the activity is expressly allowed for by a resource consent, a rule in a regional plan, or by national regulations. Permits authorising the discharge of wastes to land are issued by the Council under Section 87(e) of the RMA.

## Land use permits

Section 13(1)(a) of the RMA stipulates that no person may in relation to the bed of any lake or river use, erect, reconstruct, place, alter, extend, remove, or demolish any structure or part of any structure in, on, under, or over the bed, unless the activity is expressly allowed for by a resource consent, a rule in a regional plan, or by national regulations. Land use permits are issued by the Council under Section 87(a) of the RMA.

## Coastal permits

Section 12(1)(b) of the RMA stipulates that no person may erect, reconstruct, place, alter, extend, remove, or demolish any structure that is fixed in, on, under, or over any foreshore or seabed, unless the activity is expressly allowed for by a resource consent, a rule in a regional plan, or by national regulations. Coastal permits are issued by the Council under Section 87(c) of the RMA.

**Discharge Permit**  
**Pursuant to the Resource Management Act 1991**  
**a resource consent is hereby granted by the**  
**Taranaki Regional Council**

Name of  
Consent Holder:           New Plymouth District Council  
Private Bag 2025  
NEW PLYMOUTH

Consent Granted  
Date:                         6 December 2002

**Conditions of Consent**

Consent Granted:         To discharge up to 17 cubic metres/day of treated septic tank sewage effluent via soakage trenches into groundwater in the vicinity of the Onaero River at or about GR: Q19:284-448

Expiry Date:             1 June 2021

Review Date(s):         June 2009, June 2015

Site Location:           Onaero Bay Motor Camp, State Highway 3, Onaero

Legal Description:       Sec 82 Urenui Dist Blk III Waitara SD Kaipikari Farm Sett  
Rec Res

Catchment:               Onaero

## Consent 1389-3

### General conditions

- a) On receipt of a requirement from the Chief Executive, Taranaki Regional Council (hereinafter the Chief Executive), the consent holder shall, within the time specified in the requirement, supply the information required relating to the exercise of this consent.
- b) Unless it is otherwise specified in the conditions of this consent, compliance with any monitoring requirement imposed by this consent must be at the consent holder's own expense.
- c) The consent holder shall pay to the Council all required administrative charges fixed by the Council pursuant to section 36 in relation to:
  - i) the administration, monitoring and supervision of this consent; and
  - ii) charges authorised by regulations.

### Special conditions

1. The consent holder shall, in conjunction with the Taranaki Regional Council, undertake such bacteriological monitoring of the Onaero River and coastal waters of the foreshore as deemed necessary by the Chief Executive, Taranaki Regional Council.
2. The consent holder shall ensure proper maintenance of the septic tanks, pumping station and soakage trenches as required.
3. The consent holder shall provide records of daily effluent volumes discharged to the soakage trenches at the request of the Chief Executive, Taranaki Regional Council.
4. The consent holder shall provide a contingency plan to the satisfaction of the Chief Executive, Taranaki Regional Council, outlining measures to be undertaken in the event of power failure, pump breakdown, pipe blockage and failure of soakage trenches, within three months of granting this consent.
5. In accordance with section 128 and section 129 of the Resource Management Act 1991, the Taranaki Regional Council may serve notice of its intention to review, amend, delete or add to the conditions of this resource consent by giving notice of review during the month of June 2009 and/or June 2015, for the purpose of ensuring that the conditions are adequate to deal with any adverse effects on the environment arising from the exercise of this resource consent, which were either not foreseen at the time the application was considered or which it was not appropriate to deal with at the time.

Signed at Stratford on 6 December 2002

For and on behalf of  
Taranaki Regional Council

---

**Director-Resource Management**

**Discharge Permit**  
**Pursuant to the Resource Management Act 1991**  
**a resource consent is hereby granted by the**  
**Taranaki Regional Council**

Name of  
Consent Holder:           New Plymouth District Council  
Private Bag 2025  
NEW PLYMOUTH

Consent Granted  
Date:                         6 December 2002

**Conditions of Consent**

Consent Granted:         To discharge up to 85 cubic metres/day of treated septic  
tank sewage effluent via soakage trenches into  
groundwater in the vicinity of the Urenui River at or about  
GR: Q19:310-452

Expiry Date:               1 June 2021

Review Date(s):         June 2009, June 2015

Site Location:             Urenui Beach Motor Camp, Beach Road, Urenui

Legal Description:        Lot 1 DP 15787 Blk III Waitara SD

Catchment:                Urenui

## Consent 2046-3

### General conditions

- a) On receipt of a requirement from the Chief Executive, Taranaki Regional Council (hereinafter the Chief Executive), the consent holder shall, within the time specified in the requirement, supply the information required relating to the exercise of this consent.
- b) Unless it is otherwise specified in the conditions of this consent, compliance with any monitoring requirement imposed by this consent must be at the consent holder's own expense.
- c) The consent holder shall pay to the Council all required administrative charges fixed by the Council pursuant to section 36 in relation to:
  - i) the administration, monitoring and supervision of this consent; and
  - ii) charges authorised by regulations.

### Special conditions

1. The consent holder shall, in conjunction with the Taranaki Regional Council, undertake such bacteriological monitoring of the Urenui River and coastal waters of the foreshore as deemed necessary by the Chief Executive, Taranaki Regional Council.
2. The consent holder shall ensure proper maintenance of the septic tanks, pumping station and soakage trenches as required.
3. The consent holder shall provide records of daily effluent volumes discharged to the soakage trenches at the request of the Chief Executive, Taranaki Regional Council.
4. The consent holder shall provide a contingency plan to the satisfaction of the Chief Executive, Taranaki Regional Council, outlining measures to be undertaken in the event of power failure, pump breakdown, pipe blockage and failure of soakage trenches, within three months of granting this consent.
5. In accordance with section 128 and section 129 of the Resource Management Act 1991, the Taranaki Regional Council may serve notice of its intention to review, amend, delete or add to the conditions of this resource consent by giving notice of review during the month of June 2009 and/or June 2015, for the purpose of ensuring that the conditions are adequate to deal with any adverse effects on the environment arising from the exercise of this resource consent, which were either not foreseen at the time the application was considered or which it was not appropriate to deal with at the time.

Signed at Stratford on 6 December 2002

For and on behalf of  
Taranaki Regional Council

---

**Director-Resource Management**